

CINNATI®

Preparation Prior to Equipment Arrival

In order to anticipate problems that may cause delays at equipment arrival, we recommend reviewing the following:

1. Size of door opening.
2. Overhead clearances.
3. Plant obstructions in route to machine foundation.
4. Capacity of cranes or other lifting devices.
5. Capacity of rigging, if used.
6. Internal personnel or professional riggers.
7. Code requirements for all services. (Electrical, etc.)
8. Spreader bar. (Lifting device to span lifting points)
9. Location of equipment within plant to allow efficient operation and disassembly if necessary.

To aid you, we are providing the following information on the machine specifications sheet:

Approximate shipping weight in pounds

Machine Housing or Link (link mechanical shear) Thickness in inches

Machine Lifting Hole Size in inches

This information will enable you to determine the clevis or lifting bar size necessary to rig your machine from an overhead crane or to have it moved by acceptable floor methods.

Please refer to your foundation print to determine the distance between the machine housing. Also note the illustration in the Equipment Preparation section of this document. Make your spreader bar sufficient size to maintain housing position when lifting the machine.

Electrical control enclosure is mounted on the RIGHT HAND side. The full door opening, in inches, is available on the machine data sheet.

Please reference your foundation print and insure sufficient clearance for this extended door opening measurement.

Equipment Arrival

All Cincinnati equipment must pass a Quality Control inspection prior to being released for shipment. We strongly recommend that the following steps be taken upon arrival of the equipment at your facility.

A. Inspect equipment upon arrival for damage.

1. Equipment is shipped FOB Whitewater, Ohio, unless otherwise specified
2. The equipment should be inspected before unloading for such things as rust, due to torn shipping tarp, machinery movement resulting in damaged valves, piping, structural damage, etc. Damage should be noted on the shipper's bill of lading and a hidden damage claim filed.
3. In the event equipment is damaged, a claim should be filed with the carrier. We suggest contacting a CINCINNATI INCORPORATED Service Representative for necessary estimates of repair so they can be undertaken before start-up. Should CINCINNATI INCORPORATED Field Personnel be required to investigate a damage claim, a formal purchase order from the machine owner will be required.

B. Verify that all equipment has arrived and is unloaded from carrier

1. Compare received equipment to PACKING LIST
2. In the event all equipment was not received, a claim should be filed with the carrier and a CINCINNATI INCORPORATED Branch Office or authorized distributor should be contacted so missing parts can be reshipped before startup.

C. Equipment Unloading

1. It is the customer's responsibility to properly unload all equipment from the carrier.
2. Refer to the lifting photograph in the operation, safety and maintenance manual for your machine.

Equipment Preparation and Installation Suggestions

Refer to your Operation, Safety and Maintenance Manual for suggested installation procedures under the section labeled INSTALLATION. This manual will be shipped with your machine. An electronic copy of the manual is also available on this pre-installation site in the Additional Services page.

Equipment Service Connections

- The foundation plan specifies the requirements for water and/ or compressed air when required on the machine. The mixes of all air and water connections will be shown on the foundation plan.

The foundation plan also contains electrical full load current information for the machine. This information will be used to determine wire and conduit sizes for electrical supply line to the machine location. It will be the customer's responsibility to run the electrical to the machine shut off (including transformer). The supply should be in position before the machine is installed.

It is very important the Local, State and National electrical codes be checked prior to connecting the service wire to the machine disconnect switch.

Unless your local electrical codes are more restrictive, use the National Electrical Code (NFPA 70) to size the electrical service drop for the machine as follows:

1. The full load current is listed on the certified foundation print and the machine nameplate. Using the 60 degree C and 75 degree C columns for copper wire in Table 310-16, size the

supply conductors for 125% of the full load current.

For disconnect switches rated 100 amps or above, use the 75 degree column (where permitted by the manufacturer). Wire rated above 75 degrees C can be used by the ampacity shall be sized from either the 60 degree or 75 degree columns.

2. After the wire size and type has been determined, refer to chapter 9, table I, for sizing the conduit. See tables 3A, 3B and 3C for the number of conductors (all of the same size) permitted in conduit trade sizes of tubing 1/2 inch through 6 inch.

Connect the equipment grounding wire to the ground lug adjacent to the disconnect switch.

Use NEMA 12 type fittings for the incoming service and ground wire connections to the machine in order to maintain the OIL tight integrity of the electrical enclosures.

Please contact a CINCINNATI INCORPORATED Service Representative as to your anticipated start-up date so we may schedule start-up of your machine.

INPUT POWER REQUIREMENTS

The equipment furnished contains electrical controls which are sensitive to input power fluctuations and high voltage transients. The main power supplied should be as "clean" as possible to prevent control errors and increase machine reliability. Protection against normal high voltage spikes and voltage fluctuations is built into the machine control. Unless otherwise specified on the certified foundation plan, limits on input power for proper machine operation is as follows (NFPA 79 Section 3-7):

Supply voltage: Rated Voltage +/- 10%

Supply frequency: Rated Frequency +/- 2%

Impulse Voltage: Not to exceed 200% peak voltage up to 1 millisecond duration with a rise time of 500 nanoseconds to 500 microseconds.

Voltage Drop: Not to exceed a reduction of 50% of peak voltage for 1/2 cycle or 20% for one cycle with more than one second between successive reductions.

If variations from these parameters do exist, please contact CINCINNATI INCORPORATED for line conditioning recommendations or additional information.

GROUNDING REQUIREMENTS

Equipment grounding supplied by the customer for safe and proper operation shall consist of the following **GROUNDING ELECTRODE SYSTEM** and **GROUNDING CONDUCTOR**.

Machine must be properly grounded in accordance with the National Electric Code NFPA 70, 2002 edition, Article 250, Sections 50 through 70. CINCINNATI INCORPORATED recommends using an individual electrode per Article 250-52 (5) to avoid interference from other equipment.

AUXILLARY EQUIPMENT

Any auxiliary equipment that will be attached to or used in conjunction with CINCINNATI INCORPORATED machines, shall have an R-C suppression network in parallel with each inductive load (relay coil, solenoid, etc.) which is turned on and off during normal operation. The suppression network should be located as close as possible to each inductive load.

Please contact CINCINNATI INCORPORATED if additional information or parts are required.

CINCINNATI